

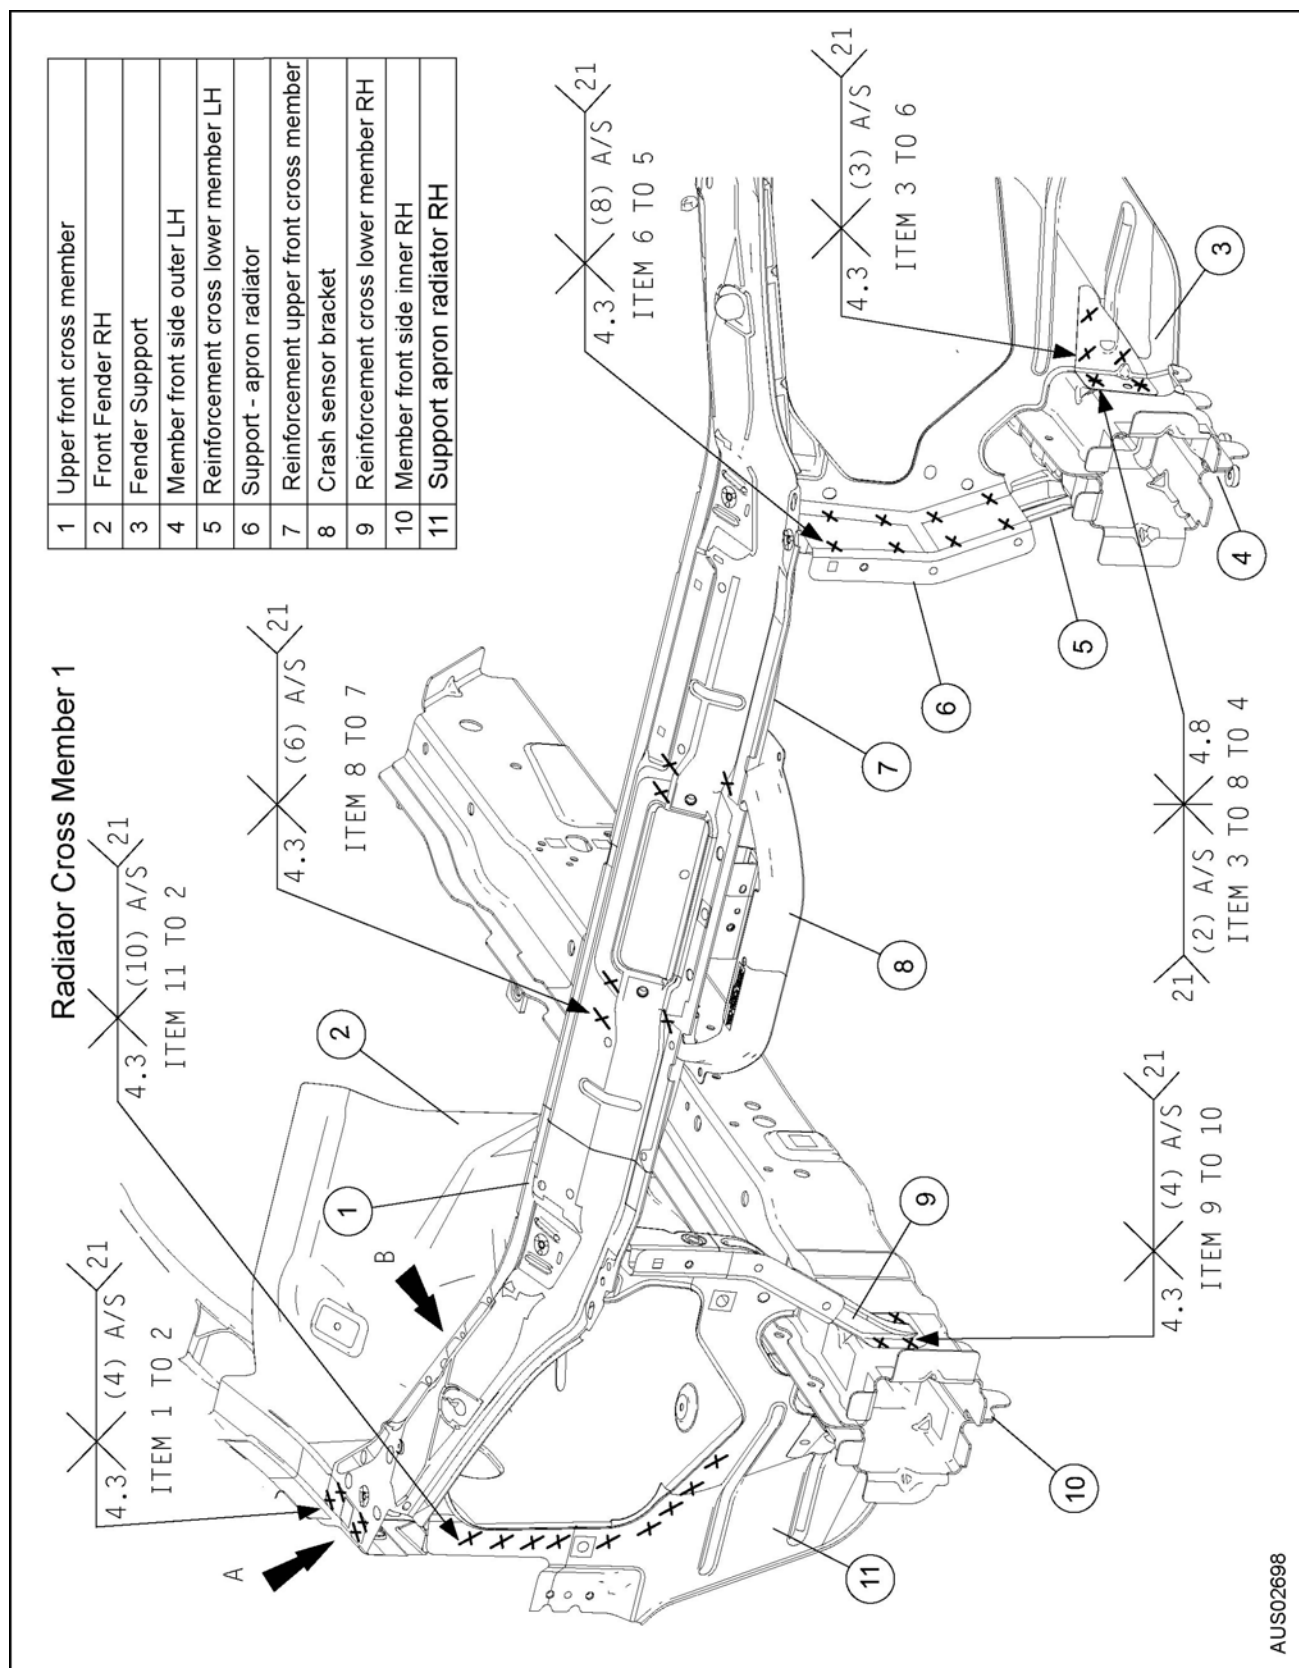
## SECTION 501-27: Front End Sheet Metal Repairs

**VEHICLE APPLICATION :** 2003.0 BA Falcon

### CONTENTS

#### WELD INFORMATION

Radiator Cross Member 1 .....	501-27-2
Radiator Cross Member 1a .....	501-27-3
Towel Rail Replacement .....	501-27-3
Radiator Cross Member 2 .....	501-27-4
Radiator Cross Member 3 .....	501-27-4
Apron and Side Member .....	501-27-5
Front Apron LHS .....	501-27-5
Front Apron RHS .....	501-27-6
Fender to Body LHS .....	501-27-6
Fender to Body RHS .....	501-27-7
Front Apron LHS 1 .....	501-27-7
Front Apron RHS 1 .....	501-27-8

**WELD INFORMATION**

WELD INFORMATION (Continued)

Radiator Cross Member 1a

VIEW B

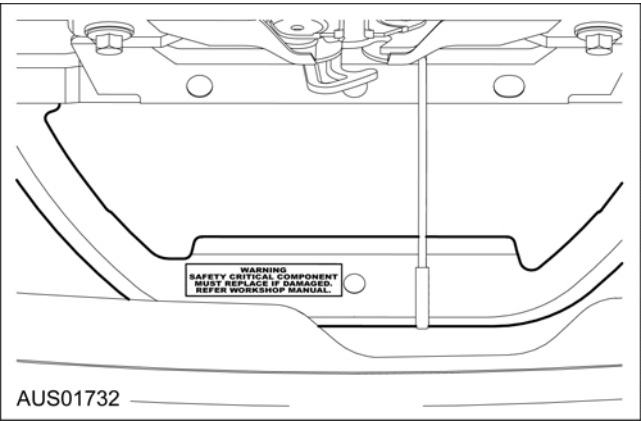
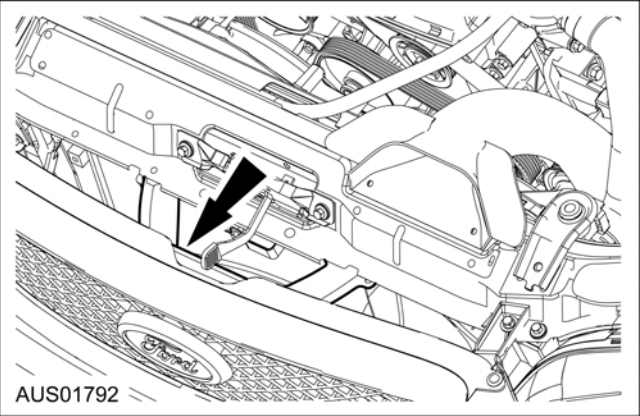
VIEW A  
ITEM 2 REMOVED

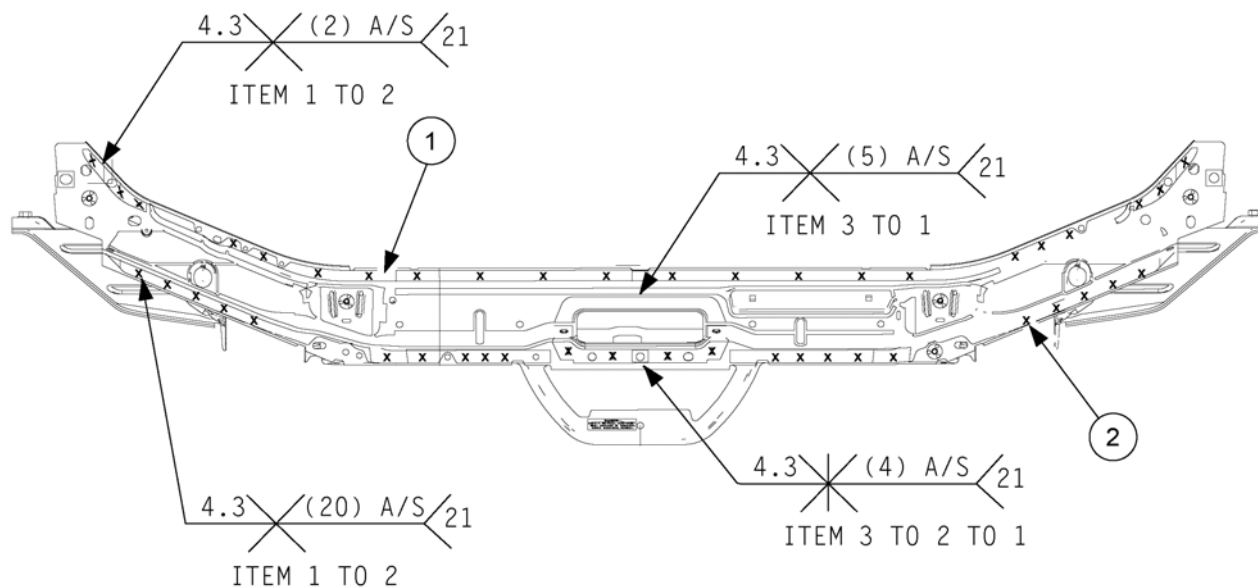
1	Support Apron
2	Upper Front Cross Member
3	Front Fender
4	Reinforcement Upper Front Cross Member

AUS02712

Towel Rail Replacement

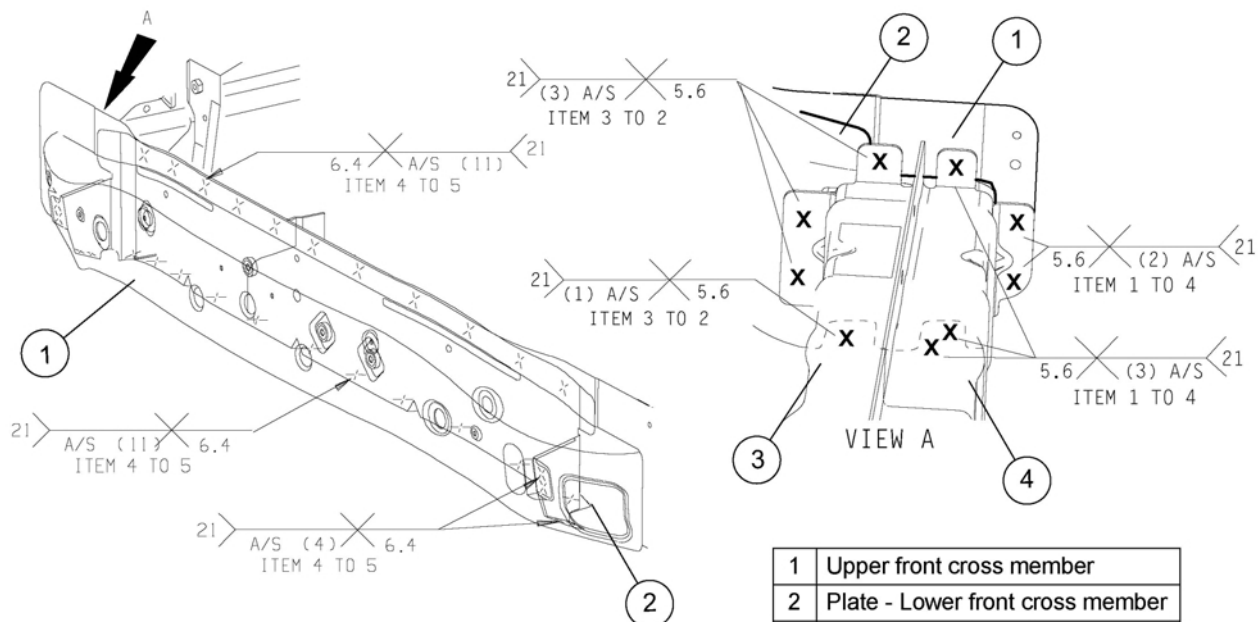
The Towel Rail on the front upper X member must be replaced if damaged. It MUST NOT be straightened or panel beaten. This is critical for correct function of the crash severity sensor which plays a major part in activating the front airbags in a crash.



**WELD INFORMATION (Continued)****Radiator Cross Member 2**

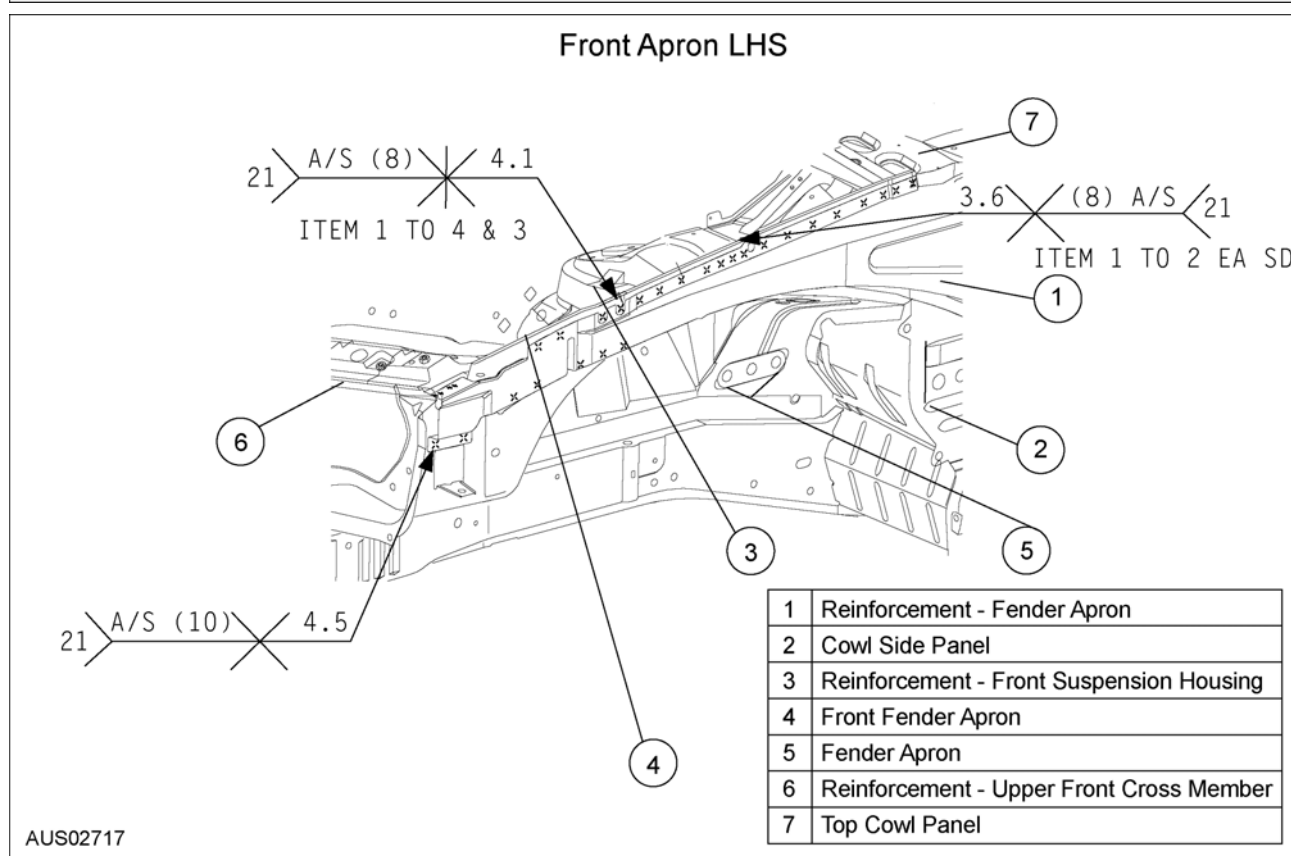
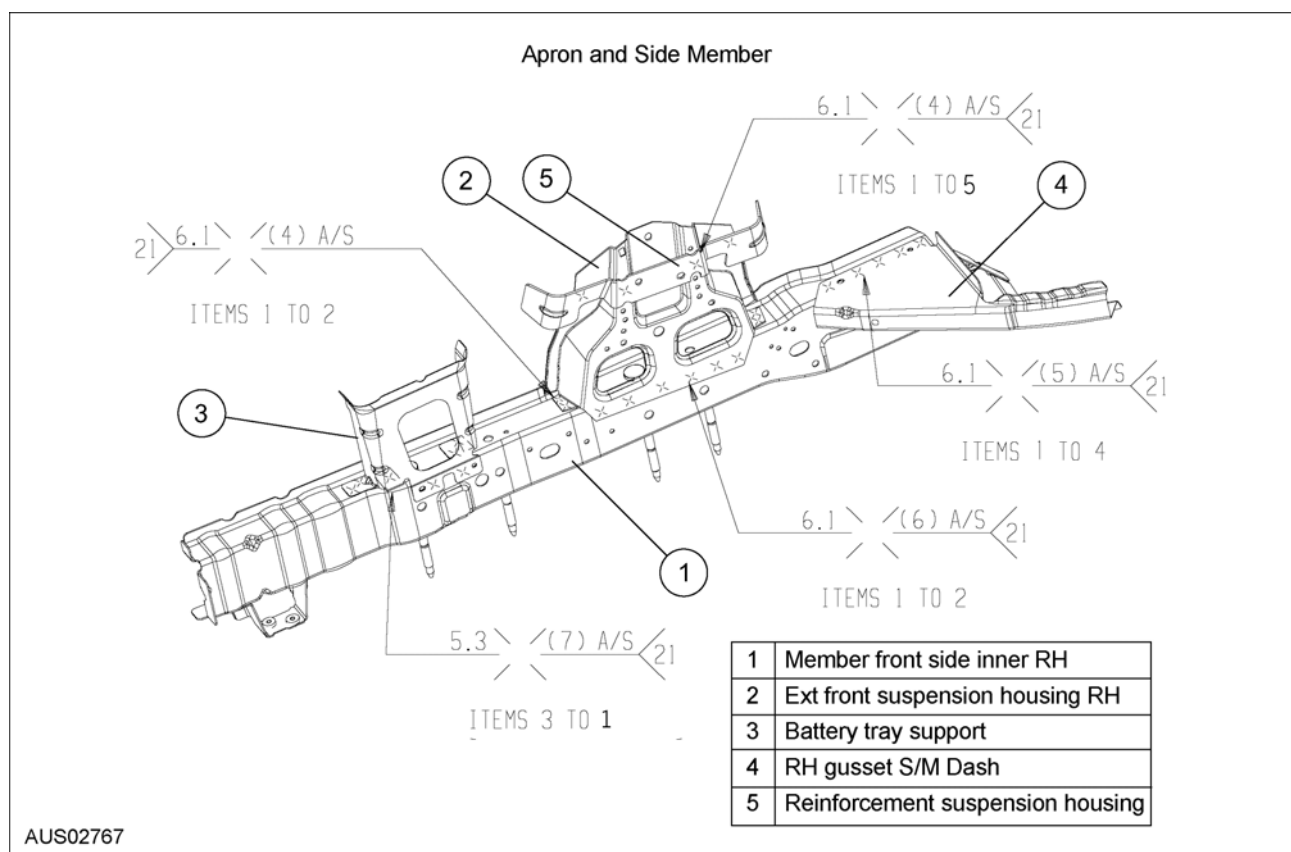
1	Upper Front Cross Member
2	Reinforcement - Upper Front Cross Member
3	Support Hood Latch

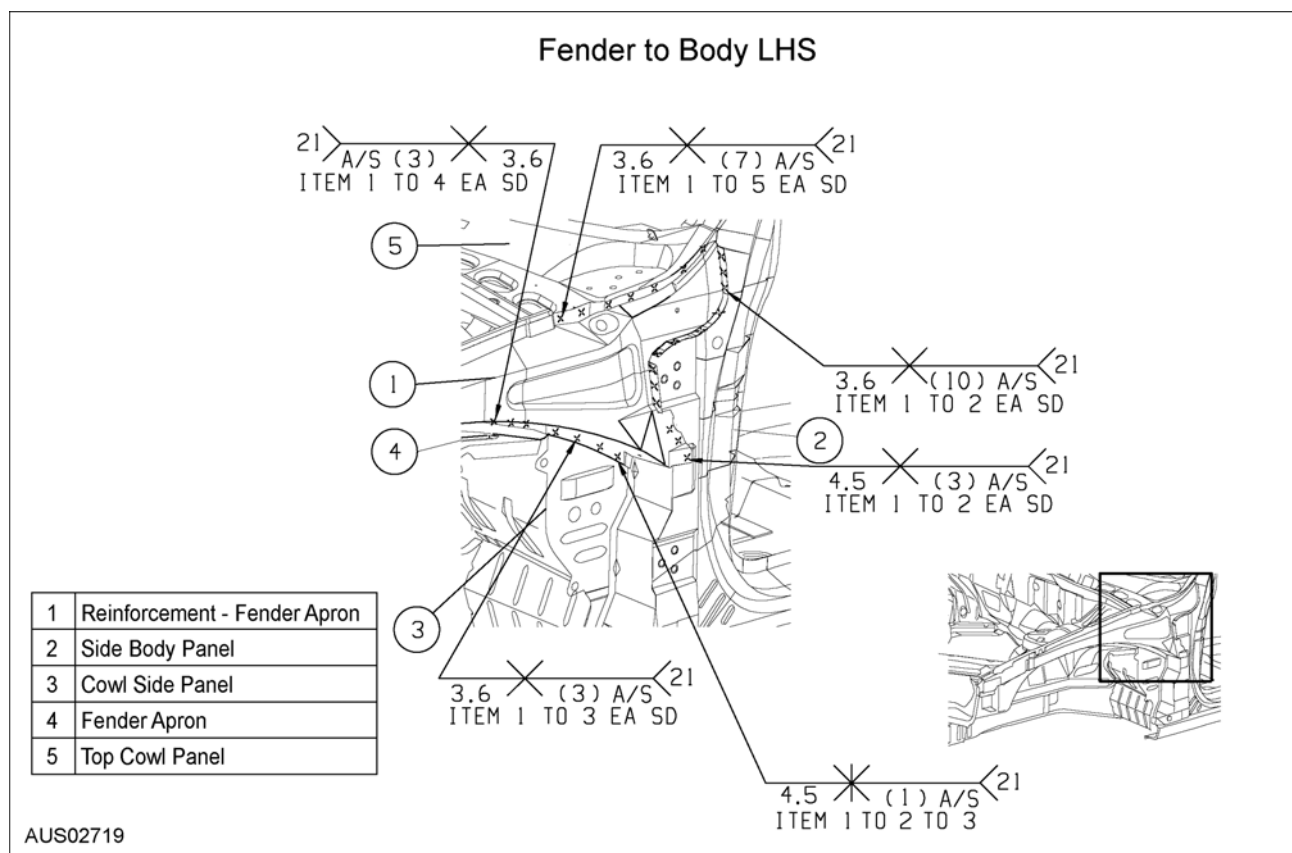
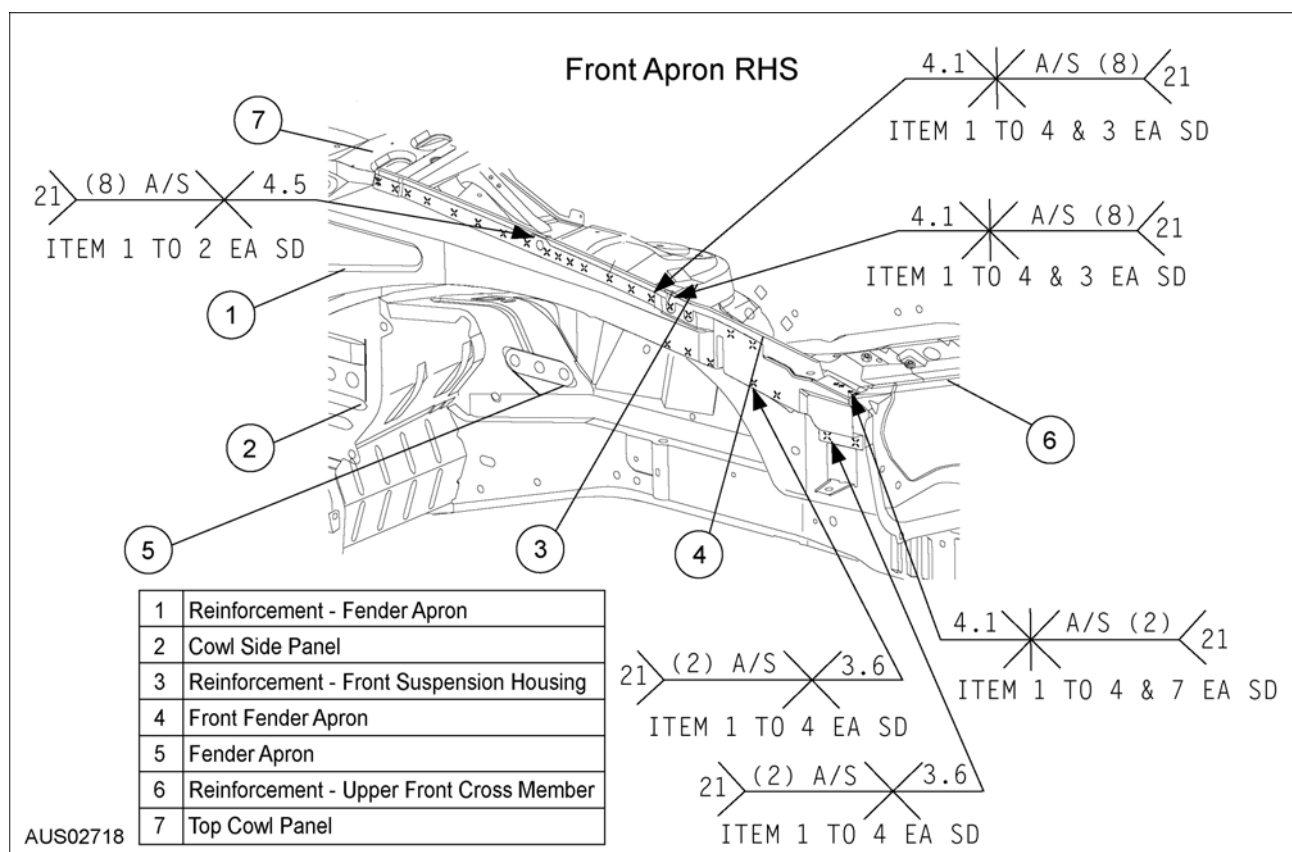
AUS02716

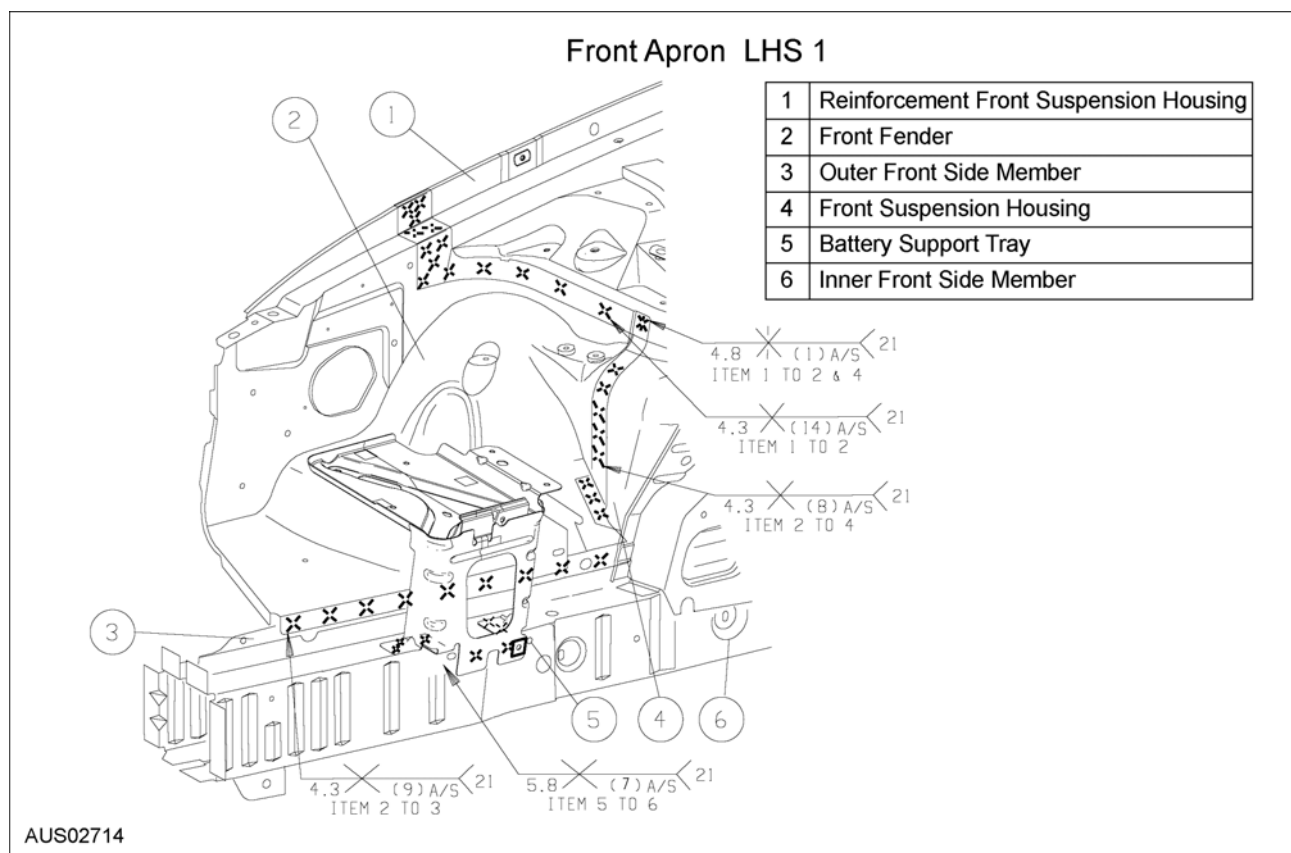
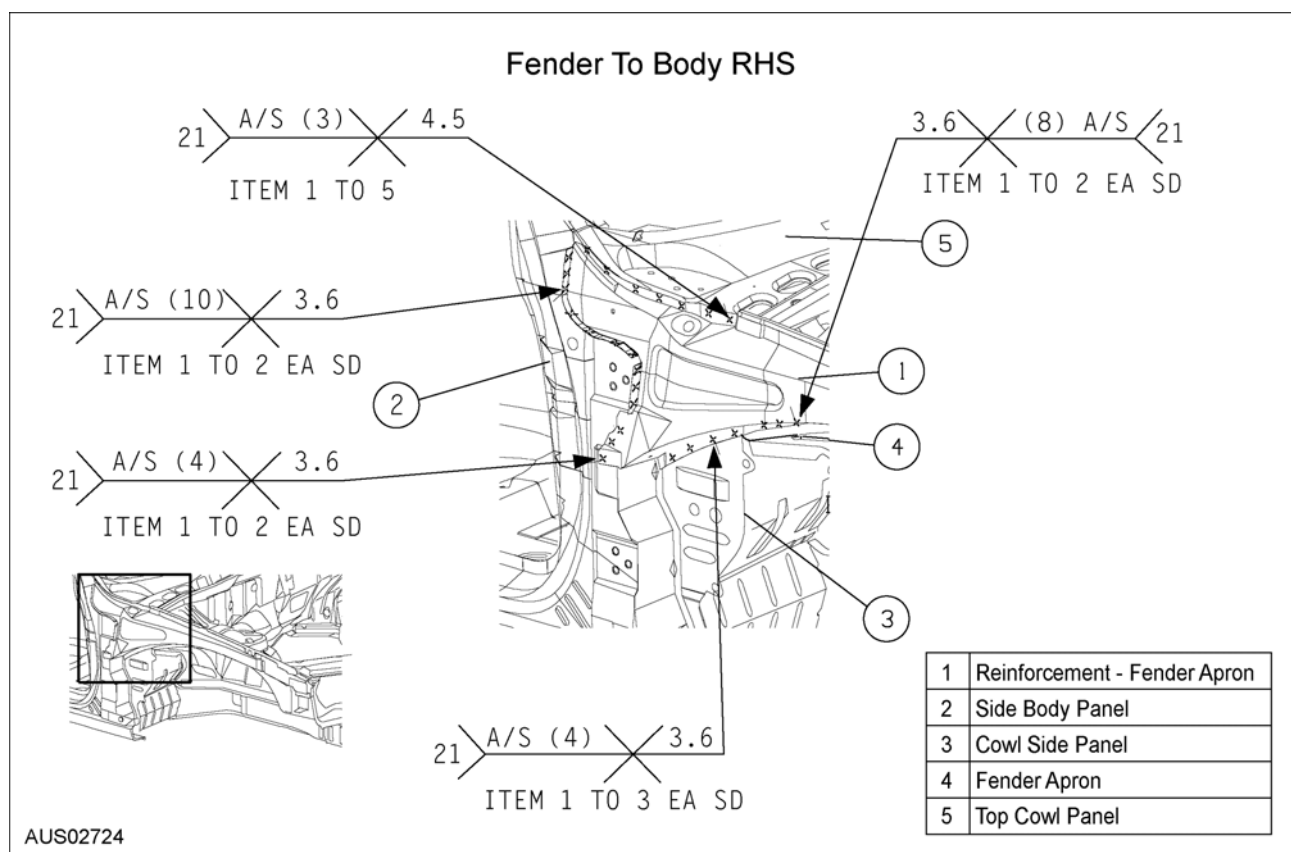
**Radiator Cross Member 3**

1	Upper front cross member
2	Plate - Lower front cross member
3	Inner front side member
4	Outer front side member

AUS02713

**WELD INFORMATION (Continued)**

**WELD INFORMATION (Continued)**

**WELD INFORMATION (Continued)**

**WELD INFORMATION (Continued)**